

Date: Tuesday, 10/3/2006 2:47:45 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : SHORT STEP ASSEMBLY HIGH SKID RH
Job Number : 28817	
Estimate Number : 10720	
P.O. Number : N/A	Part Number : D350591214
This Issue : 10/3/2006 S.O. No. : N/A	Drawing Number : D3078 REV A
Prsht Rev. : NC	Project Number : N/A
First Issue : N/A Type : LARGE FAB ASSY	Drawing Revision : A
Previous Run : 27618	Material : N/A
Written By : <u> </u>	Due Date : 10/18/2006 Qty: 10 Um: Each
Checked & Approved By : <u> </u>	
Comment : Est Rev:B 05-10-14 Modified step 10 KJ/EC	
Est Rev:C 06-06-19 Added D2732-030 AS PER DSI9294 JLM	
Est Rev:C 06-06-27 Revised as per DSI9340 JLM	

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and type labels as per PPP D350-591-214 CHG002

RE 06-10-04

2.0	D2622120C	Extrusion
-----	-----------	-----------



Comment: Qty.: 0.5000 Each(s)/Unit Total: 5.0000 Each(s)

Pick:

Qty Part Number

Description Batch

.5 D2622-120

Extrusion

B27077
B27215

RE 06-10-26

3.0	LARGE FAB 1	LARGE FABRICATION RESOURCE 1
-----	-------------	------------------------------



Comment: LARGE FABRICATION RESOURCE 1

1-Cut D2622-120 extrusion to 59.75" long as per Dwg D3078

2-Drill extrusion as per Dwg D3078 using Jig DT8680 for rivets.

3-Deburr

RE 06-10-26

RE 06-10-26

RE 06-10-26

4.0	QC5	INSPECT WORK TO CURRENT STEP
-----	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

PD 06-10-26

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D.350-591-214 PAR #: N/A Fault Category: Prod / Fab. Pass ^{LARGE} NCR: Yes No DQAI: Yes Date: 06/12/06
 QA: N/C Closed: Yes Date: 06.12.07

NCR: <u>28817</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
06/10/30	3.0.	Drill jig not placed in the proper location. one side drilled, Drill jig positioned properly, opposite side didn't line up square.	<u>OS1042</u>	Scrap: destroy & replace.	<u>DE</u> 06-10-30	<u>OS1042</u> 06-10-30	<u>OS1042</u>	<u>OS1042</u> 06/10/30

NOTE: Date & initial all entries

Date: Tuesday, 10/3/2006 2:47:45 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SHORT STEP ASSEMBLY HIGH SKID RH

Job Number: 28817

Part Number: D350591214

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

D30671

End Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 10.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3067-1

End Plate 328270

~~328270~~

KE. 06-10-26

6.0

D30631

Support



Comment: Qty.: 1.0000 Each(s)/Unit Total: 10.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3063-1

Support 328241

KE. 06-10-26

7.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Bevel end for welding FWD*ONLY

2-Weld Support using Jig DT8681, weld Fwd End Plate as per QSI 004 & Dwg D3078

A/R Aluminum Rod M18838 M19612

3-Grind End Plate flush

KE. 06-10-26

KE. 06-10-27

KE. 06-10-30

8.0

QC5/9

WELD INSPECTION



Comment: Inspect weld and work to Step 9

FC 06-10-30

06/10/30 (10)

9.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

YLA 06/11/22

X 10

10.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FC 06 11 22 (10)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/3/2006 2:47:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SHORT STEP ASSEMBLY HIGH SKID RH

Job Number: 28817

Part Number: D350591214

Job Number:



Seq. #:

Machine Or Operation:

Description :

11.0

D3065041

Step Leg Assembly



Comment: Qty.: 1.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3065-041

Step Leg Assy

327590

PE. 06.12.1

10

12.0

D30661

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 D3066-1

Spacer

329234=8

329409=12

PE. 06.12.1

10

13.0

MS20600AD4W4

Rivets



Comment: Qty.: 16.0000 Each(s)/Unit Total : 160.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

16 MS20600AD4W4

Rivet

17100649

PE. 06.12.1

10

14.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

Rivet Leg Assembly as per Dwg D3078.

PE. 06.12.01

10

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

PE. 06.12.01

10

16.0

D30671

End Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick:

Qty Part Number—Description

Batch

1 D3067-1

End Plate

328270

PE. 06.12.01

10

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/3/2006 2:47:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SHORT STEP ASSEMBLY HIGH SKID RH

Job Number: 28817

Part Number: D350591214

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Bevel Aft end for welding

2-Inspect for foreign object as per QSI 024

3-Weld Aft End Plate as per QSI 004 & Dwg D3078

A/R Aluminum Rod *M1100237*

4-Grind End Plate flush

PE 06.12.01 10
PE 06.12.01 10
PE 06.12.01 10
PE 06.12.04 10

18.0

QC5/9

WELD INSPECTION



Comment: Inspect work & Weld to Current - Check dimension 108.93" & 9.375" as per Dwg D3078

06/12/04 (10)

19.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Touch Up Chemical conversion

Q.M

06/12/04

(10X)

20.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

Q.M 06/12/05

(10X)

21.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Wing Walk as per Dwg D3078 and QSI 005 4.4

FC 06 12 05 (10)

22.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: Inspect Powder Coat and Wing Walk

AB 06 12 05 (10)

23.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

Join to reference only.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/3/2006 2:47:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SH0RT STEP ASSEMBLY HIGH SKID RH

Job Number: 28817

Part Number: D350591214

Job Number:



Seq. #:

Machine Or Operation:

Description :

24.0

D2182B

Neoprene Cushion-.750 bl



Comment: Qty.: 0.3000 f(s)/Unit Total : 3.0000 f(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2182b035 Rubber Cushion

25.0

D2274

Radius Block



Comment: Qty.: 4.0000 Each(s)/Unit Total : 40.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

4 D2274 Radius Block

26.0

D2732

Rubber Extrusion



Comment: Qty.: 0.2500 f(s)/Unit Total : 2.5000 f(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2732-030 Rubber Cushion

See attached

27.0

D2856400

Abrasion Strip



Comment: Qty.: 0.6000 f(s)/Unit Total : 6.0000 f(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D2856-400(7.2") Abrasion Strip

28.0

D22301

Mounting Lug



Comment: Qty.: 2.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2230-1 Clamp

29.0

D2732

Rubber Extrusion



Comment: Qty.: 0.5000 f(s)/Unit Total : 5.0000 f(s)

Rubber Extrusion

2 X 3"

Batch: _____

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/3/2006 2:47:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SH0RT STEP ASSEMBLY HIGH SKID RH

Job Number: 28817

Part Number: D350591214

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D22303

Mounting Lug



Comment: Qty.: 2.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2230-3 Clamp

31.0

AN335A

Bolt



Comment: Qty.: 6.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

6 AN3-35A Bolt

32.0

AN411A

Bolt



Comment: Qty.: 6.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

6 AN4-11A Bolt

see attached

33.0

AN960JD10

Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 40.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

4 AN960JD10 Washer

34.0

AN960JD416

Washer



Comment: Qty.: 12.0000 Each(s)/Unit Total : 120.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

12 AN960JD416 Washer

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/3/2006 2:47:46 PM
Usér: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SHORT STEP ASSEMBLY HIGH SKID RH

Job Number: 28817

Part Number: D350591214

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

MS21042L3

Nut



Comment: Qty.: 2.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 MS21042L3 Nut (or -3) _____

36.0

MS21042L4

Nut



Comment: Qty.: 6.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick: Packing Kit •

Qty Part Number Description Batch

6 MS21042L4 Nut (or -4) _____

Steel
2 Holes

37.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

38.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D350-591-214

Location: _____

PPP Rev: _____

10/4/12/07 *(10)*

39.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>CP</i>	DRAWN BY <i>CP</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>#</i>	APPROVED <i>#</i>	DRAWING NO. D3078	REV. A SHEET 1 OF 2
DATE 02.09.11		TITLE STEP ASSEMBLY, HI SHORT SCALE NTS	
A	02.09.11	NEW ISSUE	

RELEASED
02.09.20 *#*

Part No.	Description	QTY -041	QTY -042
D3078-041	Step Assembly, High Short (LH)	X	
D3078-042	Step Assembly, High Short (RH)		X
D2622-60	STEP EXTRUSION	1	1
D3063-1	SUPPORT	1	1
D3065-041	LEG ASSEMBLY	1	1
D3066-1	SPACER	2	2
D3067-1	END PLATE	2	2
MS20600AD4W4	RIVET	16	16

GENERAL NOTES:

- 1) -041 SHOWN, FOR -042 INSTALL D3063-1 SUPPORT OPPOSITE SIDE
- 2) WELD PER DART QSI 004
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT ASSEMBLY WHITE (4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT PER DART QSI 005 4.4
- 4) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 28817

COPYRIGHT © 2002 BY DART AEROSPACE LTD.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DART




DESIGN	UP	DRAWN BY	UP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA
CHECKED	✓	APPROVED	✓	REV. A
DATE	02.09.11	TITLE	D3078	SHEET 2 OF 2
			STEP ASSEMBLY, HI SHORT	SCALE 1:20

RELEASED
02.09.2011

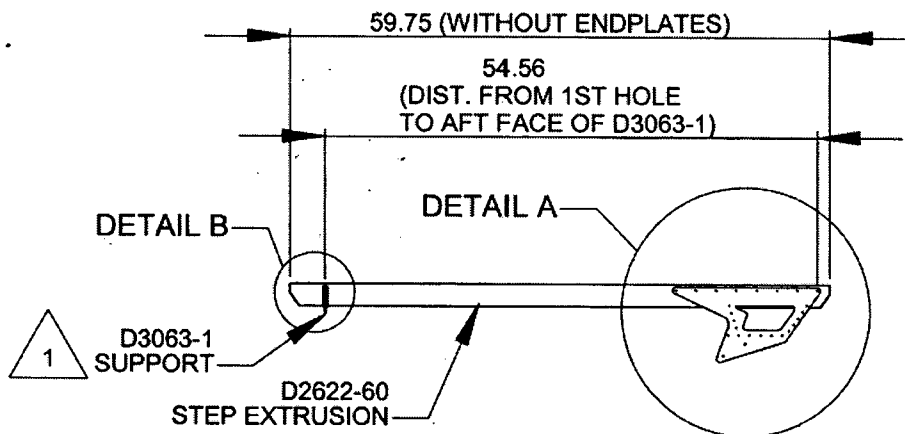

D.O.I.

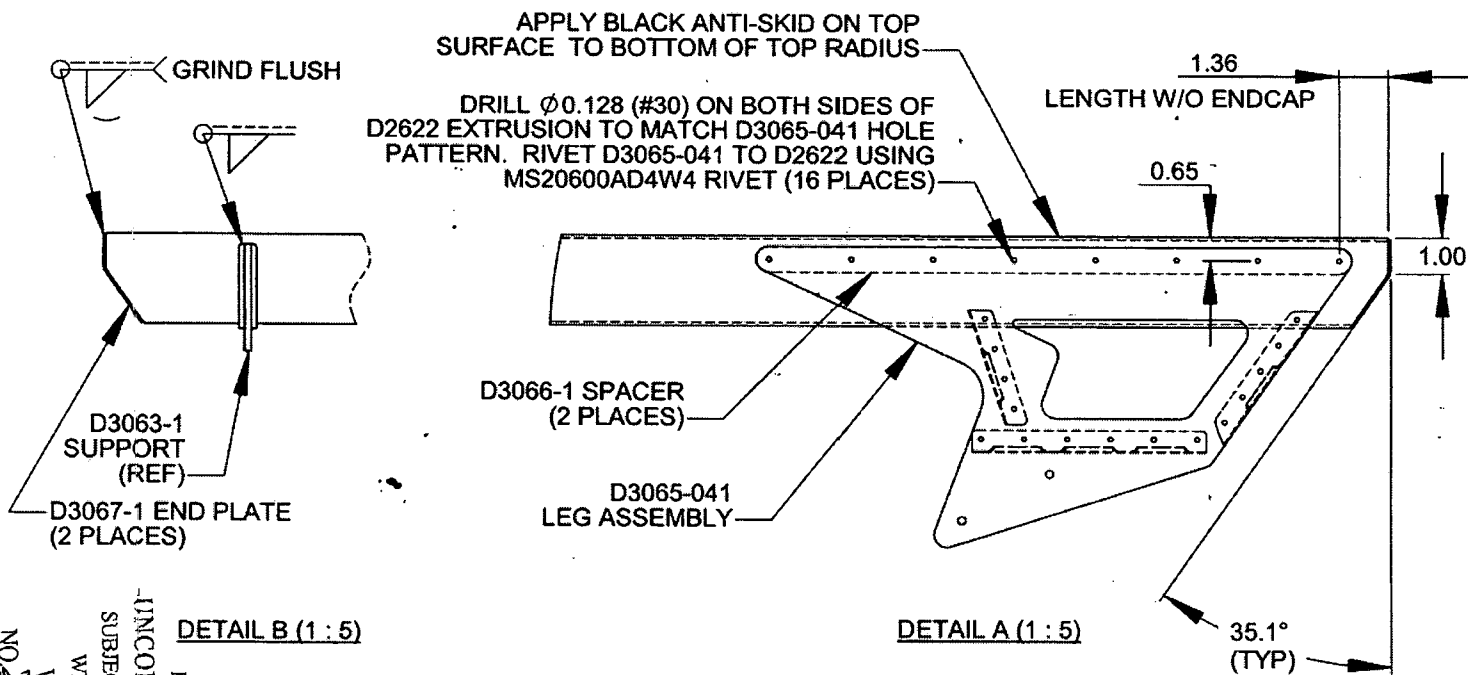

SHOP COPY
RETURN TO
ENGINEERING
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
WORK ORDER
NO 28817

COPYRIGHT © 2002 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SHORT STEP ASSEMBLY HIGH SKID RH

Job Number: 28817

REFERENCE ONLY

Part Number: D350591214

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Bevel Aft end for welding

2-Inspect for foreign object as per QSI 024

3-Weld Aft End Plate as per QSI 004 & Dwg D3078

A/R Aluminum Rod 11180237

4-Grind End Plate flush

PE 06.12.01 10
PE 06.12.01 10
PE 06.12.01 10
PE 06.12.04 10

18.0

QC5/9

WELD INSPECTION



Comment: Inspect work & Weld to Current - Check dimension 100.00" & 3.375" as per Dwg D3072

19.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Touch Up Chemical conversion

Q.M

06/12/04

(10X)

20.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

Q.M 06/12/05

(10X)

21.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Wing Walk as per Dwg D3078 and QSI 005 4.4

22.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: Inspect Powder Coat and Wing Walk

23.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SHORT STEP ASSEMBLY HIGH SKID RH

Job Number: 28817

Part Number: D350591214

Job Number:



Seq. #:

Machine Or Operation:

Description :

24.0

D2182B

Neoprene Cushion-.750 bl



Comment: Qty.: 0.3000 f(s)/Unit Total : 3.0000 f(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2182b035 Rubber Cushion B28042 ✓

25.0

D2274

Radius Block



Comment: Qty.: 4.0000 Each(s)/Unit Total : 40.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

4 D2274 Radius Block B28824 x 32, B28713 x 8 ✓

26.0

D2732

Rubber Extrusion



Comment: Qty.: 0.2500 f(s)/Unit Total : 2.5000 f(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2732-030 Rubber Cushion

N/A

27.0

D2856400

Abrasion Strip



Comment: Qty.: 0.6000 f(s)/Unit Total : 6.0000 f(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D2856-400(7.2") Abrasion Strip B28258 ✓

28.0

D22301

Mounting Lug



Comment: Qty.: 2.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2230-1 Clamp B28902 ✓

29.0

D2732

Rubber Extrusion



Comment: Qty.: 0.5000 f(s)/Unit Total : 5.0000 f(s)

Rubber Extrusion

12 X 3"

Batch: B26472 ✓

← only 5.0000 F(s) was taken out of computer system.

1506/12/06

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SHORT STEP ASSEMBLY HIGH SKID RH

Job Number: 28817

Part Number: D350591214

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D22303

Mounting Lug



Comment: Qty.: 2.0000 Each(s)/Unit Total: 20.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2230-3

Clamp

359646 ✓

31.0

AN335A

Bolt



Comment: Qty.: 6.0000 Each(s)/Unit Total: 60.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

6 AN3-35A

Bolt

1101723 ✓

32.0

AN411A

Bolt



Comment: Qty.: 6.0000 Each(s)/Unit Total: 60.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

6 AN4-11A

Bolt

1100743 ✓

33.0

AN960JD10

Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total: 40.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

4 AN960JD10

Washer

1100743 ✓

34.0

AN960JD416

Washer



Comment: Qty.: 12.0000 Each(s)/Unit Total: 120.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

12 AN960JD416

Washer

1102339 ✓

EB 06/12/06

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SHORT STEP ASSEMBLY HIGH SKID RH

Job Number: 28817

Part Number: D350591214

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

MS21042L3 4

Nut



Comment: Qty.: 2.0000 Each(s)/Unit Total: 20.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 MS21042L3

Nut (or -3)

M101917 ✓

36.0

MS21042L4 1

Nut



Comment: Qty.: 6.0000 Each(s)/Unit Total: 60.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

6 MS21042L4

Nut (or -4)

M19185 ✓

1306/12/06 (10)

37.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

10/6/12/06 (10)

38.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D350-591-214

Location: _____

PPP Rev: _____

C

10/6/12/07 (10)

39.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

10/6/12/07

Job Completion



11/26/12/07